



Hyper Krome Ag 1K Kit Manual

Thank you for purchasing Hyper Krome Ag 1K Kit.

Read this instruction manual carefully and thoroughly before using the appliance, and then use it correctly.

SHOW UP developed Hyper Krome Ag 1K Kit to provide more excellent Hyper Krome Ag to all customers for Model industry. It is a single stage coating and is drying quickly from base color to topcoat clear. Its workability becomes better than a double stage coating and it reduces working hours as well.

Hyper Krome Ag 1K Kit Contents

- Hyper Krome Ag 15ml
- Base color black for Hyper Krome Ag 15ml
- Topcoat clear for Hyper Krome Ag 15ml

1. Spraying Base color black for Hyper Krome Ag 1K Kit

Regarding Hyper Krome Ag, the more mirror plating the base color's surface is, the more beautiful the silver plating appears. First of all, pretreating as usual, and spraying base color black to remove dusts. **Dry at 40 – 50 degrees with a household heater for about 30 minutes or dry at 20 – 25 degrees (at ordinary temperature) for a couple of hours after spraying base color black. Please don't touch during the drying process. Fingerprints could come out after the final stage with topcoat clear if touch a little.**

2. Spraying Hyper Krome Ag

Put undiluted solution of Hyper Krome Ag in a spray gun. (you don't have to dilute it with thinner or something.) Air blowing the base color black to remove dusts without touching then spraying Hyper Krome Ag.

From semidry painting to semiwet painting with an air blush or spray gun 4 – 5 times, which each interval should be about 5 minutes.

Silver plating gradually appears during the drying process even though deep brown appears just after Hyper Krome Ag painting. **Dry at 40 – 50 degrees with a household heater for about 30 minutes or dry at 20 – 25 degrees (at ordinary temperature) for a couple of hours after spraying Hyper Krome Ag.**

3. Spraying topcoat clear for Hyper Krome Ag 1K Kit

Spraying topcoat clear for Hyper Krome Ag on complete dried Hyper Krome Ag.

First, super dry painting about 2 – 3 times, which interval should be about 5 minutes.

Dry at 40 – 50 degrees with a household heater for about 30 minutes or dry at 20 – 25 degrees (at ordinary temperature) for a couple of hours after super dry painting topcoat clear.

Furthermore, semiwet painting topcoat clear once, wet painting once, and finish all.

Each interval should be 5 minutes.

Notice:

- superdry painting(mist of first step) – semidry painting(second step) – semiwet painting(third step of light painting without gloss third step) – wet(final painting for gloss)
- Recommendation using within 6 months after purchasing the products
- Please keep this product in the room. Especially in winter and at extremely cold regions.
- Hyper Krome Ag is affected by humidity. Silver reaction of Hyper Krome Ag could be damaged by moisture. Please don't paint on a rainy day if possible.

Signal Inc., SHOW UP Division
2-6-8 Aoshinke Mino Si, Osaka Japan
Tel. 072-727-7123 Fax. 072-727-2678
Email. info@showup.jp
<http://www.showup.jp/Ag1K.html>

